PAGE: 1

PRINT DATE: 09/01/93

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CRITICAL HARDWARE NUMBER: 05-6N-2018-X

SUBSYSTEM NAME: EPD&C - AUXILIARY POWER UNIT

REVISION:

1

08/30/93

PART NAME VENDOR NAME

PART NUMBER VENDOR NUMBER

LRU

: AFT PCA 4, 5, 6

V070-765280

SRU

: DIODE

JANTX1N1188R

PART DATA

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

DIODE, BLOCKING (35 AMP) - AUXILIARY POWER UNIT (APU) CONTROLLER 1, 2, AND 3 POWER

REFERENCE DESIGNATORS: 0V102:

54V76A134A4CR5 54V76A134A4CR6 55V76A135A4CR5 55V76A135A4CR6 56V76A136A4CR5 56V76A136A4CR6

OV-103 AND SUBS: 54V76A134A2CR6 54V76A134A2CR6 55V76A135A2CR6 55V76A136A2CR6 56V76A136A2CR6 56V76A136A2CR6

QUANTITY OF LIKE ITEMS: 6

\$IX

FUNCTION:

PROVIDES MAIN BUS ISOLATION AND CONDUCTS CIRCUIT CURRENT IN REDUNDANT INPUTS TO APU CONTROLLERS 1, 2, AND 3.

PAGE: Z- PRINT DATE: 09/01/93

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CRITICAL FAILURE MODE

NUMBER: 05-6N-2018-01

REVISION# 1 08/30/93

SUBSYSTEM NAME: EPD&C - AUXILIARY POWER UNIT

LRU: AFT PCA 4, 5, 6 CRITICALITY OF THIS ITEM NAME: DIODE FAILURE MODE: 1R3

FAILURE MODE:

OPEN, FAILS TO CONDUCT

MISSION PHASE:

PL PRELAUNCH LO LIFT-OFF OO ON-ORBIT DO DE-ORBIT

LS LANDING SAFING

VEHICLE/PAYLOAD/KIT EFFECTIVITY: 102 COLUMBIA

103 DISCOVERY 104 ATLANTIS 105 ENDEAVOUR

CAUSE:

STRUCTURAL FAILURE (MECHANICAL STRESS, VIBRATION), ELECTRICAL STRESS, THERMAL STRESS, PROCESSING ANOMALY

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN A) |

A) PASS

B) FAIL

C) PASS

PASS/FAIL RATIONALE:

A)

B)

FIRST FAILURE NOT DETECTABLE BECAUSE THIS APU CIRCUIT IS PARALLEL REDUNDANT.

C)

- FAILURE EFFECTS -

(A) SUBSYSTEM:

LOSS OF REDUNDANT POWER TO APU CONTROLLER.

(B) INTERFACING SUBSYSTEM(S):

LOSS OF INTERFACE REDUNDANCY. THE REDUNDANT CIRCUIT PROVIDES POWER TO THE APU CONTROLLER.

(C) MISSION:

PAGE: 5

PRINT DATE: 09/01/93

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CRITICAL HARDWARE

NUMBER: 05-6N-2018-01

NO EFFECT - FIRST FAILURE. SECOND FAILURE - LOSS OF APU; ABORT DECISION REQUIRED.

(D) CREW, VEHICLE, AND ELEMENT(S):

NO EFFECT - FIRST FAILURE. SECOND FAILURE - LOSS OF APU; ABORT DECISION REQUIRED.

(E) FUNCTIONAL CRITICALITY EFFECTS:

PÓSSIBLE LOSS OF VEHICLE AND CREW AFTER TWO OTHER FAILURES (DIODE FAILS OPEN, LOSS OF SECOND APU) DUE TO LOSS OF ELECTRICAL POWER NECESSARY FOR OPERATION OF CRITICAL LOADS.

-DISPOSITION RATIONALE-

(A) DESIGN:

RÉFER TO APPENDIX F. ITEM NO. 1 - DIODE, POWER - STUD MOUNTED

(B) TEST:

REFER TO APPENDIX F, ITEM NO. 1 - DIODE, POWER - STUD MOUNTED -

GROUND TURNAROUND TEST - APU 1/2/3 CONTROLLER TEST THROUGH GROUND CONNECTION PERFORMED EVERY FLOW OR AFTER LRU RETEST OF APU ASSEMBLY, AFTER LRU RETEST OF CONTROLLER ASSEMBLY OR AFTER CIG RETEST.

(C) INSPECTION:

RÉFER TO APPENDIX F, ITEM NO. 1 - DIODE, POWER - STUD MOUNTED

(D) FAILURE HISTORY:

RÉFER TO APPENDIX F. ITEM NO. 1 - DIODE, POWER - STUD MOUNTED

(E) OPERATIONAL USE:

NÓNE

ş.

- APPROVALS -		
EDITORIALLY APPROVED EDITORIALLY APPROVED TECHNICAL APPROVAL	: RI : JSC : VIA CR	Supple 9/1/92 55/2010L 9/1/92

 $0.5 \pm 6M \pm 0.6$